


BEECHCRAFT

58 P BARON

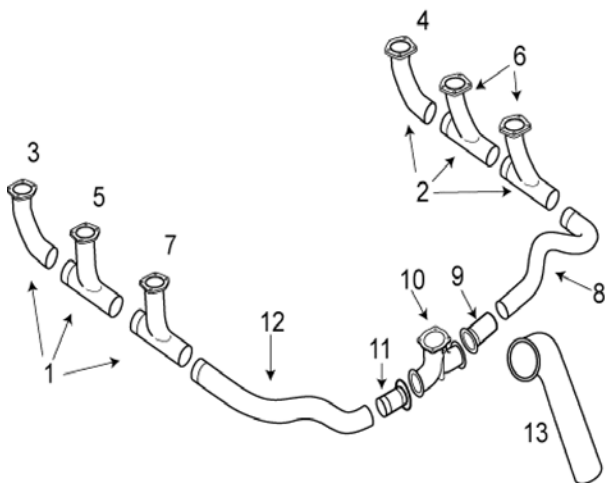

AD 76-13-09 Inspect elbows for cracks and distortion. Header has a minimum allowable thickness of .075"

Inspect elbows for chafing on engine mount beam
 Inspect flow divider plate for cracking and erosion
 Inspect body of header for blistering
 Inspect tailpipe for pitting

ITEM	OEM PART NO	DESCRIPTION	Condition
01	640707L-R	LH STACK ASSY	OH
02	640705R-R	RH STACK ASSY	OH
03	640707	LH FWD RISER CYL #6	OH
04	640705	RH FWD RISER CYL #5	OH
05	640677	LH CENTER RISER CYL #4	OH
06	640704	RH AFT RISER CYL #1	OH
06	640704	RH CENTER RISER #3	OH
07	640706	LH AFT RISER CYL# 2	OH
08	640710	RH ELBOW	OH
09	640711	RH FLANGE	OH
10	640712	HEADER	OH
11	642066	LH FLANGE	OH
12	642067	LH ELBOW	OH
13	102-950001-15	TAIL PIPE	OH
NS	628260	GASKET	NEW
NS	NH1000897-50	TAILPIPE CLAMP	NEW