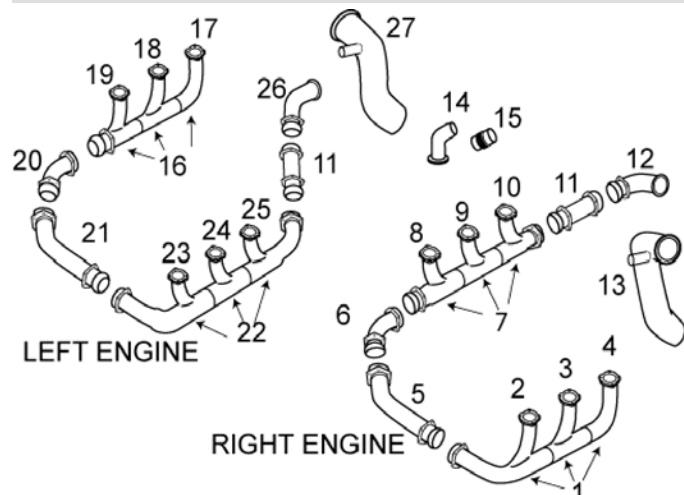


CESSNA**421A/B Golden Eagle****Subject to AD 2000-01-16**

AWI is authorized by the FAA to meet the overhaul requirements (paragraph "G") on AD 2000-01-16.

Visual inspection every 50 hrs. or 30 days

Remove tailpipes inspect for cracks every 12 mo.

Inspect & pressure test exhaust system every 12 mo.

Replace multi-segment V-band clamps every 500 hrs.

Remove the exhaust system from the slip joints aft to all turbo charger components every 2,500 hrs. or 12 yrs. which ever occurs first.

Check all Slip Joints for Freedom of movement

Check all parts for internal pitting

ITEM	OEM PART NO	DESCRIPTION	Condition
01	5155156-213	RH INBD STACK	OH
02	5155156-22	RH INBD FWD RISER	OH
03	5155156-23	RH INBD CTR RISER	OH
04	5155156-24	RH INBD AFT RISER	OH
05	9910379-16	5 BOLT RH x-OVER	OH
05	996-46	3 BOLT RH X-OVER	OH
06	9910379-18	5 BOLT RH ELBOW	OH
06	996-52	3 BOLT RH ELBOW	OH
07	5155156-207	RH OTBD STACK ASSY	OH
08	5155156-19	RH OTBD FWD RISER	OH
09	5155156-18	RH OTBD CTR RISER	OH
10	5155156-17	RH OTBD AFT RISER	OH
11	9910314-1	SLIP JOINT	OH
12	9910379-20	RH TURBO INLET	OH
13	5155156-4	RH TAIL PIPE	OH
14	5155156-5	BY-PASS ELBOW	OH
15	5155157-1	SLEEVE	OH
16	5155156-205	LH INBD STK ASSY	OH
17	5155156-12	LH INBD FWD RISER	OH
18	5155156-13	LH INBD CTR RISER	OH
19	5155156-14	LH INBD AFT RISER	OH
20	966-54	3 BOLT LH ELBOW	OH
20	9910379-17	5 BOLT LH ELBOW	OH
21	966-50	3 BOLT LH X-OVER	OH
21	9910379-15	5 BOLT LH X-OVER	OH
22	5155156-204	LH OTBD STK ASSY	OH
23	5155156-7	LH OTBD FWD RISER	OH
24	5155156-8	LH OTBD CTR RISER	OH
25	5155156-9	LH OTBD AFT RISER	OH
26	9910379-19	LH TURBO INLET	OH
27	5155156-3	LH TAIL PIPE	OH
NS	1001-6	SPRING KIT	NEW
NS	5155122-HD	HARDWARE KIT	NEW