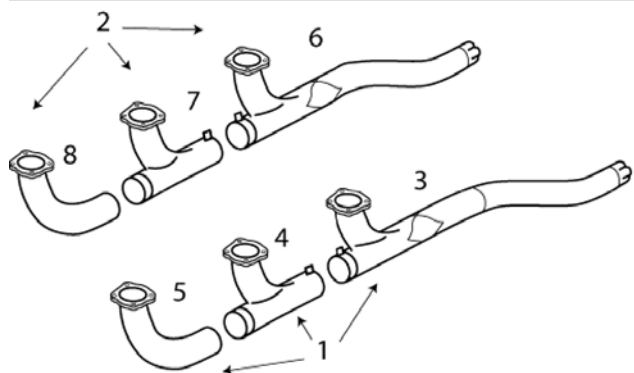


**CESSNA****310 UNDERWING**


Slip joint assemblies should easily slide in and out of each other.

Check all parts especially tailpipes for internal pitting.

Check slip joints for wear.

Check for cracks at tabs between center and aft risers.

ITEM	OEM PART NO	DESCRIPTION	Condition
01	0850670-37	LH STACK ASSEMBLY	OH
02	0850670-36	RH STACK ASSEMBLY W/ MIXTURE CONTROL	OH
02	0850670-38	RH STACK ASSEMBLY	OH
03	0850730-1	LH AFT RISER	OH
04	0850600-89	LH CTR RISER	OH
05	0850600-91	LH FWD RISER	OH
06	0850730-2	RH AFT RISER	OH
06	0850730-8	RH AFT RISER W/MIXTURE CONTROL	OH
07	0850600-88	RH CTR RISER	OH
08	0850600-90	RH FWD RISER	OH
NS	0851110-1	SHROUD INTAKE	OH
NS	628260	GASKET	NEW

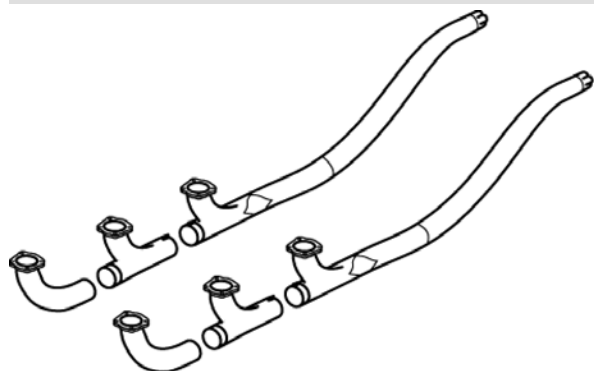**310 OVERWING**

Slip joint assemblies should easily slide in and out of each other.

Check all parts especially tailpipes for internal pitting.

Check slip joints for wear.

Check for cracks between center and aft risers.

ITEM	OEM PART NO	DESCRIPTION	Condition
01	0850600L-R	LH STACK ASSEMBLY	OH
02	0850600R-R	RH STACK ASSEMBLY	OH
03	0850627-3	LH AFT	OH
04	0850600-43	LH CTR RISER	OH
05	0850600-49	LH FWD RISER	OH
06	0850627-4	RH AFT	OH
07	0850600-44	RH CTR RISER	OH
08	0850600-50	RH FWD RISER	OH
NS	628260	GASKET	NEW