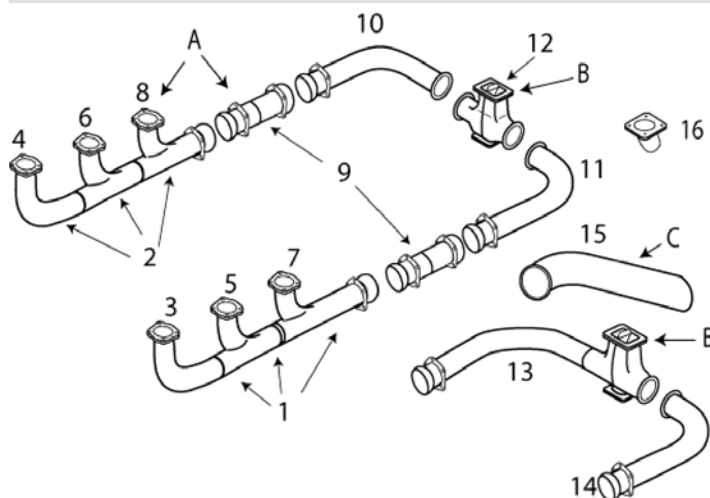


CESSNA**310 /320/ 401/ 402****Subject to AD 2000-01-16**

AWI is authorized by the FAA to meet the overhaul requirements (paragraph "G") on AD 2000-01-16.

Visual inspection every 50 hrs. or 30 days
Remove tailpipes inspect for cracks every 12 mo.
Inspect & pressure test exhaust system every 12 mo.

Replace multi-segment V-band clamps every 500 hrs.

Remove the exhaust system from the slip joints aft to all turbo charger components every 2,500 hrs. or 12 yrs. which ever occurs first.

Pay special attention to:

- A Inspect all slip joints for movement
- B Check flow divider plate for cracks or distortion
- C Check tailpipe for internal pitting and wall thickness

ITEM	OEM PART NO	DESCRIPTION	Condition
01	9910295-13	LH STACK ASSY	OH
02	9910295-14	RH STACK ASSY	OH
03	9910295-17	LH FWD RISER	OH
04	9910295-18	RH FWD RISER	OH
05	9910295-19	LH CENTER RISER	OH
06	9910295-20	RH CTR RISER	OH
07	9910295-21	LH AFT RISER	OH
08	9910295-22	RH AFT RISER	OH
09	A9910296-7	SLIP JOINT S.S.	NEW
10	0850712-33	LH IB STK ELBOW	OH
10	9910301-3	LH IB STK ELBOW	OH
11	0850712-31	LH OB STK ELBOW	OH
11	9910301-1	LH OB STK ELBOW	OH
12	0850712-35	LH HEADER ASSY	OH
12	9910301-4	LH HEADER ASSY	OH
13	0850712-34	RH HEADER ASSY	OH
13	9910301-6	RH HEADER ASSY	OH
14	0850712-32	RH IB STK ELBOW	OH
14	9910301-5	RH IB STK ELBOW	OH
15	K0850711-43	LH TAIL PIPE	NEW
15	K0850711-44	RH TAIL PIPE	NEW
16	0850713-1	WG OB PIPE	OH
NS	0850711-41	LH TAIL PIPE Box style	OH
NS	0850711-42	RH TAIL PIPE Box style	OH
NS	0851053-1	HEAT SHIELD	OH
NS	0851053-5	HEAT SHIELD	OH
NS	5050154-15	WASTEGATE	
NS	9910295LE-HD	LE HARDWARE KIT (see inside of back cover)	NEW
NS	9910295RE-HD	RE HARDWARE KIT (see inside of back cover)	NEW